# KRIZVIEW PARK (PWS 4010178) SOURCE WATER ASSESSMENT FINAL REPORT

June 6, 2002



# State of Idaho Department of Environmental Quality

**Disclaimer:** This publication has been developed as part of an informational service for the source water assessments of public water systems in Idaho and is based on data available at the time and the professional judgement of the staff. Although reasonable efforts have been made to present accurate information, no guarantees, including expressed or implied warranties of any kind, are made with respect to this publication by the State of Idaho or any of its agencies, employees, or agents, who also assume no legal responsibility for the accuracy of presentations, comments, or other information in this publication. The assessment is subject to modification if new data is produced.

## **Executive Summary**

Under the Safe Drinking Water Act Amendments of 1996, all states are required by the U.S. Environmental Protection Agency (EPA) to assess every source of public drinking water for its relative sensitivity to contaminants regulated by the Act. This assessment is based on a land use inventory of the designated assessment area and sensitivity factors associated with the wells and aquifer characteristics.

This report, *Source Water Assessment for Krizview Park, Boise, Idaho*, describes the public drinking water system, the boundaries of the zones of water contribution, and the associated potential contaminant sources located within these boundaries. This assessment should be used as a planning tool, taken into account with local knowledge and concerns, to develop and implement appropriate protection measures for this source. The results should <u>not be</u> used as an absolute measure of risk and they should <u>not be</u> used to undermine public confidence in the water system.

The Krizview Park (PWS #4010178) drinking water system consists of one well. The system currently serves 120 people through 32 connections. Little is known about the well's history except that its casing extends to a depth of 54 feet. No information was available as to when it was constructed.

Final susceptibility scores are derived from equally weighting system construction scores, hydrologic sensitivity scores, and potential contaminant/land use scores. Therefore, a low rating in one or two categories coupled with a higher rating in other categories results in a final rating of low, moderate, or high susceptibility. With the potential contaminants associated with most urban and heavily agricultural areas, the best score a well can get is moderate. Potential contaminants are divided into four categories, inorganic contaminants (IOCs, i.e. nitrates, arsenic), volatile organic contaminants (VOCs, i.e. petroleum products), synthetic organic contaminants (SOCs, i.e. pesticides), and microbial contaminants (i.e. bacteria). As different wells can be subject to various contamination settings, separate scores are given for each type of contaminant.

In terms of total susceptibility, Well #1 rates automatically high for IOCs, VOCs, SOC, and microbials. The automatically high ratings are due to the presence of mobile homes within 50 feet of the well. In addition, arsenic was detected (December 1995) in concentrations higher than the recently revised maximum contaminant level (MCL) of 10 parts per billion (ppb). System construction scores and hydrologic sensitivity scores were both high. The missing well log might have lowered the scores. Land use scores were high for IOCs and VOCs, moderate for SOCs, and low for microbials.

No SOCs have ever been tested in the well. Traces of fluoride and nitrate have been detected, but at levels significantly below the MCL. Total coliform and fecal coliform have been detected in the distribution system (March 2000). The arsenic detection was at a concentration of 13 parts per billion (ppb), a level greater than the revised MCL of 10 ppm. In October, 2001, the EPA lowered the arsenic MCL from 50 ppm to 10 ppm. However, public water systems have until 2006 to meet the new requirement. The well's delineation intersects a plume of the VOC tetrachloroethane (PCE), but none has been detected in the well yet.

This assessment should be used as a basis for determining appropriate new protection measures or reevaluating existing protection efforts. No matter what ranking a source receives, protection is always important. Whether the source is currently located in a "pristine" area or an area with numerous industrial and/or agricultural land uses that require surveillance, the way to ensure good water quality in the future is to act now to protect valuable water supply resources. If the system should need to expand in the future, new well sites should be located in areas with as few potential sources of contamination as possible, and the site should be reserved and protected for this specific use.

For the Krizview Park, drinking water protection activities should first focus on correcting any deficiencies outlined in the sanitary survey (an inspection conducted every five years with the purpose of determining the physical condition of a water system's components and its capacity). Because the arsenic in the well is greater than the level of the revised MCL, the Krizview Park users may need to consider implementing engineering controls to monitor and maintain or reduce the level of this contaminant in the water system. The EPA plans to provide up to \$20 million over the next two years for research and development of more cost-effective technologies to help small systems meet the new MCL.

Actions should be taken to keep a 50-foot radius circle clear from potential contaminants from around the wellhead. Any contaminant spills within the delineation should be carefully monitored and dealt with. As much of the designated assessment areas are outside the direct jurisdiction of Krizview Park, collaboration and partnerships with state and local agencies and industry groups should be established and are critical to success.

Due to the time involved with the movement of ground water, drinking water protection activities should be aimed at long-term management strategies even though these strategies may not yield results in the near term. A strong public education program should be a primary focus of any drinking water protection plan as the delineations are near urban and residential land uses areas. Public education topics could include proper lawn and garden care practices, household hazardous waste disposal methods, proper care and maintenance of septic systems, and the importance of water conservation to name but a few. There are multiple resources available to help communities implement protection programs, including the Drinking Water Academy of the EPA. There are transportation corridors near the delineations, therefore the Department of Transportation should be involved in protection activities. Drinking water protection activities for agriculture should be coordinated with the Idaho State Department of Agriculture, the Soil Conservation Commission, the Ada County Soil and Water Conservation and Water District, and the Natural Resources Conservation Service.

A community must incorporate a variety of strategies in order to develop a comprehensive drinking water protection plan, be they regulatory in nature (i.e. zoning, permitting) or non-regulatory in nature (i.e. good housekeeping, public education, specific best management practices). For assistance in developing protection strategies please contact the Boise Regional Office of the Idaho Department of Environmental Quality or the Idaho Rural Water Association.

# SOURCE WATER ASSESSMENT FOR KRIZVIEW PARK, BOISE, IDAHO

#### Section 1. Introduction - Basis for Assessment

The following sections contain information necessary to understand how and why this assessment was conducted. It is important to review this information to understand what the ranking of this assessment means. Maps showing the delineated source water assessment area and the inventory of significant potential sources of contamination identified within that area are included. The list of significant potential contaminant source categories and their rankings used to develop the assessment also is included.

#### **Background**

Under the Safe Drinking Water Act Amendments of 1996, all states are required by the U.S. Environmental Protection Agency (EPA) to assess every source of public drinking water for its relative susceptibility to contaminants regulated by the Safe Drinking Water Act. This assessment is based on a land use inventory of the delineated assessment area and sensitivity factors associated with the wells and aquifer characteristics.

#### Level of Accuracy and Purpose of the Assessment

Since there are over 2,900 public water sources in Idaho, there is limited time and resources to accomplish the assessments. All assessments must be completed by May of 2003. An in-depth, site-specific investigation of each significant potential source of contamination is not possible. Therefore, this assessment should be used as a planning tool, taken into account with local knowledge and concerns, to develop and implement appropriate protection measures for this source. The results should <u>not be</u> used as an absolute measure of risk and they should <u>not be</u> used to undermine public confidence in the water system.

The ultimate goal of the assessment is to provide data to local communities to develop a protection strategy for their drinking water supply system. The Idaho Department of Environmental Quality (DEQ) recognizes that pollution prevention activities generally require less time and money to implement than treatment of a public water supply system once it has been contaminated. DEQ encourages communities to balance resource protection with economic growth and development. The decision as to the amount and types of information necessary to develop a drinking water protection program should be determined by the local community based on its own needs and limitations. Wellhead or drinking water protection is one facet of a comprehensive growth plan, and it can complement ongoing local planning efforts.

## **Section 2. Conducting the Assessment**

#### **General Description of the Source Water Quality**

The Krizview Park (PWS #4010178) drinking water system consists of one well. The system currently serves 120 people through 32 connections. Little is known about the well's history except that its casing extends to a depth of 54 feet. No information was available as to when it was constructed.

A mobile home exists within 50 feet of the well and arsenic was detected (December 1995) in the well in concentrations higher than the recently revised MCL. No SOCs have ever been tested in the well. Traces of the IOCs fluoride and nitrate have been detected in the tested water, but at levels significantly below MCLs. Total coliform and fecal coliform have been detected in the distribution system (March 2000). The arsenic detection was at concentrations of 13 parts per billion (ppb), a level greater than the revised MCL of 10 ppm. In October, 2001, the EPA lowered the arsenic MCL from 50 ppm to 10 ppm. However, public water systems have until 2006 to meet the new requirement.


## **Defining the Zones of Contribution – Delineation**

The delineation process establishes the physical area around a well that will become the focal point of the assessment. The process includes mapping the boundaries of the zone of contribution into time-of-travel (TOT) zones (zones indicating the number of years necessary for a particle of water to reach a well) for water in the aquifer. DEQ contracted with BARR Engineering to perform the delineation using a combination of MODFLOW and a refined analytical element computer model approved by the EPA in determining the 3-year (Zone 1B), 6-year (Zone 2), and 10-year (Zone 3) TOT for water associated with the Boise Valley aquifer in the vicinity of the Krizview Park. The computer model used site specific data, assimilated by BARR Engineering from a variety of sources including other local area well logs, the Treasure Valley Hydrologic Project, and hydrogeologic reports (detailed below).

# Treasure Valley Hydrologic Project Information (Petrich and Urban, 1996; Neely and Crockett, 1998; Petrich et al., 1999)

The "Treasure Valley" is a geopolitical region that includes the lower Boise River sub-basin. The lower Boise River sub-basin begins where the Boise River exits the mountains near the Lucky Peak Reservoir. From Lucky Peak Dam the lower Boise River flows about 64 (river) miles northwestward through the Treasure Valley to its confluence with the Snake River. The Treasure Valley Hydrologic Project area encompasses the lower Boise River area, and extends south to the Snake River. The southern area is included in the study area because of ground water flow from the Lower Boise River basin south toward the Snake River.

FIGURE 1 - Geographic Location of Krizview Park Well #1, PWS 4010178

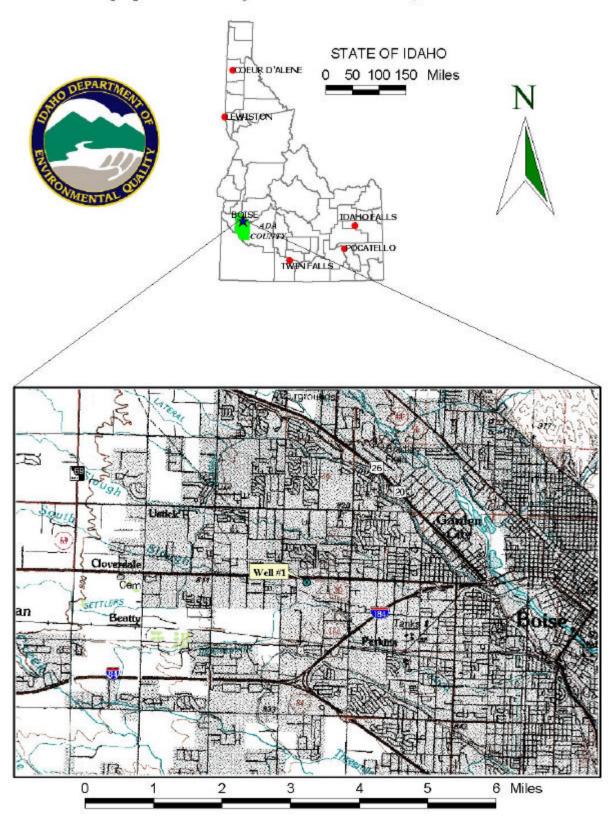

Significant amounts of desert area were converted to flood irrigated agriculture beginning in the 1860s. Irrigation led to increases in shallow ground water levels in some areas. The shallow groundwater levels provided an inexpensive and readily obtainable water supply that is used extensively throughout the valley. Much of the population growth in the Treasure Valley has been occurring in previously flood-irrigated agricultural areas, resulting in increased pumpage and a reduction in local aquifer recharge. In addition, irrigation in some areas has become more efficient, reducing the amount of irrigation-related infiltration. Decreasing aquifer recharge and increasing pumpage is thought to be contributing to decreasing ground water levels in some areas.

The Treasure Valley experiences a temperate and arid-to-semiarid climate. Average high temperatures range from about 90°F in summer to 36°F in winter; low temperatures range from about 20°F in winter to about 56°F in summer. The average precipitation ranges from about 8 to 14 inches throughout most of the valley, most of which falls during the colder months.

Major surface water bodies include the Boise River, Lake Lowell, and Lucky Peak Reservoir. The primary source of surface water in the Treasure Valley is precipitation falling in the high elevation area in the Boise River basin upstream of Lucky Peak Dam. Much of the runoff from high elevation areas is stored in three reservoirs: Anderson Ranch Reservoir, Arrowrock Reservoir, and Lucky Peak Reservoir.

The region's croplands are irrigated primarily with surface water through an extensive network of reservoirs and canals. The first canals were constructed in the 1860's; there are now over 1,100 miles of major and intermediate canals in the Treasure Valley. The primary sources of the irrigation water in the Treasure Valley include the Boise, Snake, and Payette Rivers. The majority of canals are owned and maintained by canal companies and irrigation districts.

### Hydrogeology (from Petrich et al., 1999)

The lower Boise River sub-basin (Treasure Valley) is located within the northwest-trending topographic depression known as the western Snake River Plain. The western Snake River Plain is a relatively flat lowland separating Cretaceous granitic mountains of west-central Idaho from the granitic/volcanic Owyhee mountains in southwestern Idaho. The western Snake River Plain extends from about Twin Falls, Idaho northwestward to Vale, Oregon. The Snake River Plain is about 30 miles wide in the section containing the lower Boise River.

Sediments originating from the surrounding mountains began accumulating on top of thick, basal basalts. Rifting and continued subsidence maintained the lowland topography, leading to the additional accumulation of water and sediments (Othberg, 1994). Basin infilling by sediments and basalt occurred from the late Miocene through the late Pliocene (Othberg, 1994). Incision caused by flowing water in major drainages (e.g., Snake and Boise Rivers) began in the late Pliocene or early Pleistocene, although deposition of coarse sediments continued during Quaternary glaciations (Othberg, 1994).

Several Quaternary basalt flows have been described in the western Snake River Plain, and have been assigned to the upper Snake River Group (Malde, 1991; Malde and Powers, 1962). Lava flowed across portions of the ancestral Snake River Valley (Malde, 1991) in an area that is now south of the Boise River. The Snake River then changed course, incising at its present location along the southern margin of the basalt flows. More recent eruptions (from Kuna Butte and other local sources) spilled lava into the canyon south of Melba. The Snake River has since incised this basalt (Malde, 1991).

The general stratigraphy of the western Snake River Plain consists of (from top to bottom) a thick layer of sedimentary deposits underlain by a thick series of basalt flows, which in turn are underlain by older, tuffaceous sediments and basalt (Malde, 1991; Clemens, 1993). The upper thick zone of sediments (up to approximately 6,000 feet thick) distinguishes the western Snake River Plain from the eastern Snake River Plain, in which the upper section is primarily Quaternary basalt (Wood and Anderson, 1981).

The uppermost sediments and basalt belong to the Pleistocene-age Snake River Group. The Snake River Group consists of terrace sediments, Quaternary alluvium, and Pleistocene basalt flows (Wood and Anderson, 1981). Snake River Group sediments and basalts cover much of the project area (Othberg and Stanford, 1992).

The Snake River Group overlies the Idaho Group sediments. The Idaho Group sediments can be divided into two general parts (Wood and Anderson, 1981). The lower Idaho Group contains sediments described as lake and stream deposits of buff white, brown, and gray sand, silt, clay, diatomite, numerous thin beds of vitric ash, and some basaltic tuffs. The upper part of the lower Idaho Group also contains some local, thin, basalt flows. The upper Idaho Group consists of sands, claystones, and siltstones, but differs from the lower Idaho Group in that it contains a greater percentage of coarsergrained materials. The upper Idaho Group are associated with a fluvial/deltaic/lacustrine depositional environment; the lower Idaho Group sediments were deposited in more of a lacustrine/deltaic environment (Wood, 1994).

Wood (1994) identified a buried lacustrine delta within the Idaho Group sediments in the Nampa-Caldwell area. The location of the delta in the middle of the western Snake River Plain suggests that the eastern part of the Boise River basin was delta plain and flood plain at the time of deposition, while the western part was a deep lake environment. The delta probably prograded northwestward into a lake basin 830 feet deep, based upon high resolution seismic reflection data and resistivity log interpretations. The delta-plain and front sediments were shown to be mostly fine-grained, well-sorted sand with thin layers of mud (Wood, 1994). The northwest trend of the delta indicates a sediment source to the southeast, such as where the Snake River flows today (Wood, 1994).

A substantial, laterally extensive layer of clay is found at depths of 300 to 700 feet below ground surface. The clay is important because it represents, in some areas, a significant aquitard separating shallow overlying aquifers from deeper zones. The clay, often described in well logs as having a blue or gray color, has been observed as far west as Parma, and as far east as Boise (although the clay is not found in the extreme eastern portions of the Treasure Valley). The clay varies from a few feet to a few hundred feet in thickness. Although significant layers of clay are present throughout the Idaho Group sediments, individual clay units are not necessarily continuous over large areas. Also, the top of the clay can vary in elevation by up to approximately 200 feet in some locations, such as in an area west of Lake Lowell. In general, sediments above the "blue clay" are coarser-grained than the interbedded sands, silts, and clays underlying the "blue clay."

The top of the upper Idaho Group is marked in several parts of the Treasure Valley by a widespread fluvial gravel deposit known as the Tenmile Gravels. Tenmile Gravels contain rounded granitic rocks and felsic porphyries originating from the Idaho Batholith to the north and northeast. The Tenmile gravels range up to 500 feet in thickness along the Tenmile Ridge south of Boise, but are less than 50 feet thick in the Nampa-Caldwell area (Wood and Anderson, 1981).

## **Aquifer Systems and Hydrogeologic Characteristics**

Ground water for municipal, industrial, rural domestic, and irrigation uses in the Treasure Valley is drawn almost entirely from Snake River Group and Idaho Group aquifers. Many domestic wells draw water from shallow aquifers, such as those in the Snake River Group deposits. Larger production wells (for municipal and agricultural uses) draw water from the deeper Idaho Group sediments.

Aquifers contained in the Snake River and Idaho Group sediments comprise shallow and regional ground water flow systems. Shallow aquifers contained in Snake River Group sediments and basalts may belong to local flow systems. Most local flow system recharge stems from irrigation infiltration and channel (e.g., streams or canals) losses. Discharge from shallow, local flow systems often is to local drains or streams. The time from recharge to discharge in shallow flow systems (residence times) probably ranges from days to tens of years.

In contrast, regional ground water flow systems extend much deeper than local flow systems. The Treasure Valley regional flow system begins in the eastern part of the valley, as indicated by downward hydraulic gradients in the Boise Fan sediments described by Squires et al. (1992). Some water also enters the regional flow system as underflow from the Boise Foothills in the northeastern part of the valley. The regional flow system is thought to discharge primarily to the Boise and Snake Rivers in the western and southwestern parts of the valley.

Aquifer material characteristics, material heterogeneity, and structural controls influence Treasure Valley ground water flow. Coarse-grained materials (e.g., sand and gravel) in upper zones are more capable of transmitting ground water than fine-grained sediments (e.g., silt and clay). Clay and silt in the Snake River sediments can restrict vertical and/or horizontal ground water movement. Perched aquifers are created when fine-grained lenses impede downward vertical flow. A distinctive clay layer, sometimes referred to as "blue clay," is present over large portions of the valley. The clay is absent in the easternmost portions of the lower Boise River Basin, but can reach a thickness of more than 200 feet toward the central and western portions of the basin.

Sequences of interbedded sand, silt, and clay, such as the Deer Flat Surface and the upper portion of the Glenns Ferry Formation of the upper Idaho Group in the Nampa-Caldwell area, are the major water-producing aquifers in a large part of Canyon County (Anderson and Wood, 1981). The coarse-grained sediments in this zone produce water in excess of 2,000 gallons per minute (gpm).

The delineated source water assessment area for the Krizview Park well can best be described as a southeast trending corridor approximately 4.5 miles long and almost 1 mile wide extending just to the Boise Airport (Figure 2). The actual data used by BARR Engineering in determining the source water assessment delineation areas are available from DEQ upon request.

#### **Identifying Potential Sources of Contamination**

A potential source of contamination is defined as any facility or activity that stores, uses, or produces, as a product or by-product, the contaminants regulated under the Safe Drinking Water Act and has a sufficient likelihood of releasing such contaminants at levels that could pose a concern relative to drinking water sources. The goal of the inventory process is to locate and describe those facilities, land uses, and environmental conditions that are potential sources of groundwater contamination. The locations of potential sources of contamination within the delineation areas were obtained by field surveys conducted by DEQ and from available databases.

Current land use within the area surrounding the Krizview Park well is predominately urban which was irrigated agriculture for more than a century.

It is important to understand that a release may never occur from a potential source of contamination provided they are using best management practices. Many potential sources of contamination are regulated at the federal level, state level, or both to reduce the risk of release. Therefore, when a business, facility, or property is identified as a potential contaminant source, this should not be interpreted to mean that this business, facility, or property is in violation of any local, state, or federal environmental law or regulation. What it does mean is that the <u>potential</u> for contamination exists due to the nature of the business, industry, or operation. There are a number of methods that water systems can use to work cooperatively with potential sources of contamination, including educational visits and inspections of stored materials. Many owners of such facilities may not even be aware that they are located near a public water supply well.

#### **Contaminant Source Inventory Process**

A two-phased contaminant inventory of the study area was conducted in February and March 2002. The first phase involved identifying and documenting potential contaminant sources within the Krizview Park source water assessment area (Figure 2) through the use of computer databases and Geographic Information System (GIS) maps developed by DEQ. The second, or enhanced, phase of the contaminant inventory involved contacting the operator to identify and add any additional potential sources in the delineated areas.

The delineated source water area for Well #1 (Figure 2) has many retail, service, and industrial related businesses each of which could potentially contribute at least one of the contaminant categories to the ground water. The sources identified by DEQ or the system's operator are outlined in Table 1.

Table 1. Krizview Park, Well #1, Potential Contaminant Inventory

SITE#	Source Description <sup>1</sup>	TOT Zone <sup>2</sup>	Source of Information	Potential Contaminants <sup>3</sup>
		(years)		
1, 11, 36	Service Stations-Gasoline & Oil, UST site, LUST site	3 YR	Database Search	IOC, VOC, SOC
2, 8, 63	Site Cleanup Completed , Impact: Unknown, LUST site, UST site, RCRA site	3 YR	Database Search	VOC, SOC
3	Site Cleanup Completed , Impact: Unknown, LUST site	3 YR	Database Search	VOC, SOC
4, 9, 22, 60	Auto Dealership; Closed, UST site, RCRA site, LUST site	3 YR	Database Search	VOC, SOC
5, 16, 49	Rescue Squads, Local Government; Open, UST site, LUST site	3 YR	Database Search	VOC, SOC

SITE #	Source Description <sup>1</sup>	TOT Zone <sup>2</sup> (years)	Source of Information	Potential Contaminants <sup>3</sup>		
6	Site Cleanup Completed , Impact: GROUND WATER, LUST site	3 YR	Database Search	VOC, SOC		
7, 17	Site Cleanup Completed , Impact: Unknown, LUST site, UST site	3 YR	Database Search	VOC, SOC		
10, 55, 64	Automobile Dealers-New Cars, UST site, RCRA site	3 YR	Database Search	IOC, VOC, SOC		
12	Gas Station; Open, UST site	3 YR	Database Search	IOC, VOC, SOC		
13	Commercial; Closed, UST site	3 YR	Database Search	VOC, SOC		
14, 65	Auto Dealership; Closed, UST site, RCRA site	3 YR	Database Search	IOC, VOC, SOC		
15	Auto Dealership; Closed, UST site	3 YR	Database Search	VOC, SOC		
18	Controls Control Systs/Regulators	3 YR	Database Search	IOC, VOC, SOC		
19	Photographers-Aerial	3 YR	Database Search	IOC, VOC		
20	Computer Peripherals (Manufacturer)	3 YR	Database Search	IOC, VOC, SOC		
21	Automobile Dealers-New Cars	3 YR	Database Search	IOC, VOC, SOC		
23	Home Builders	3 YR	Database Search	IOC, VOC, SOC		
24	General Contractors	3 YR	Database Search	IOC, VOC, SOC		
25	Printers	3 YR	Database Search	IOC, VOC		
26	State Government-Transportation	3 YR	Database Search	IOC, VOC, SOC		
27	Movers	3 YR	Database Search	IOC, VOC, SOC		
28	General Contractors	3 YR	Database Search	IOC, VOC, SOC		
29	Feed Ingredients (Wholesale)	3 YR	Database Search	Microbials		
30, 61	Jewelry-Manufacturers, RCRA site	3 YR	Database Search	IOC, VOC, SOC		
31	Feed Concentrates & Supplements	3 YR	Database Search	IOC, VOC, Microbials		
32	Automobile Body-Repairing & Painting	3 YR	Database Search	IOC, VOC, SOC		
33	Warehouses-Merchandise	3 YR	Database Search	IOC, VOC, SOC		
34	General Contractors	3 YR	Database Search	IOC, VOC, SOC		
35	Controls Control Systs/Regulators	3 YR	Database Search	IOC, VOC, SOC		
37	Assembly & Fabricating Service	3 YR	Database Search	IOC, VOC, SOC		
38	Laboratories-Testing	3 YR	Database Search	IOC, VOC, SOC		
39	Livestock Hauling	3 YR	Database Search	IOC, Microbials		
40	Trucking-Contract Hauling	3 YR	Database Search	VOC, SOC		
41	Newspapers (Publishers)	3 YR	Database Search	IOC, VOC		
42	Automobile Body-Repairing & Painting	3 YR	Database Search	IOC, VOC, SOC		
43	Testing	3 YR	Database Search	IOC, VOC, SOC		
44	Publishers-Directory & Guide	3 YR	Database Search	IOC, VOC		
45	Feed Concentrates & Supplements	3 YR	Database Search	IOC, Microbials		
46	Automobile Dealers-New Cars	3 YR	Database Search	10C, VOC, SOC		
47, 62	Paint-Wholesale, RCRA site	3 YR	Database Search	10C, VOC, SOC		
48 50	Automobile Detail & Clean-Up Service Lawn Maintenance	3 YR 3 YR	Database Search	IOC, VOC, SOC		
	Mechanical Contractors	3 YR	Database Search	IOC, VOC, SOC		
51 52	Publishers-Directory & Guide	3 YR	Database Search Database Search	IOC, VOC, SOC		
	Hides (Wholesale)	3 YR		IOC, VOC, SOC, Microbials		
53 54	Uninterruptible Power Systems	3 YR	Database Search Database Search	IOC, SOC, MICRODIAIS		
56	Publishers-Directory & Guide	3 YR	Database Search	IOC, VOC		
57	CERCLA site	3 YR	Database Search	IOC, VOC, SOC		
58	RCRA site	3 YR	Database Search	IOC, VOC, SOC		
59	RCRA site	3 YR	Database Search	IOC, VOC, SOC		
66	SARA site	3 YR	Database Search	IOC, VOC, SOC		
67	municipal, WLAP site	3 YR	Database Search	IOC, SOC, Microbials		
-	Interstate 184	3 YR	GIS Map	IOC, VOC, SOC, Microbials		
68	Residential; Closed, UST site	6 YR	Database Search	VOC, SOC		
69	Gas Station; Open, UST site	6 YR	Database Search	IOC, VOC, SOC		
70	Gas Station; Closed, UST site	6 YR	Database Search	VOC, SOC		
71	Gas Station; Open, UST site	6 YR	Database Search	IOC, VOC, SOC		
72	Not Listed; Closed, UST site	6 YR	Database Search	IOC, VOC, SOC		
73	Commercial; Closed, UST site	6 YR	Database Search	VOC, SOC		
74	X-Ray Laboratories-Medical	6 YR	Database Search	IOC, VOC, SOC		
75	Blueprinting	6 YR	Database Search	IOC, VOC		
76	General Contractors	6 YR	Database Search	IOC, VOC, SOC		
77, 99	Printers, RCRA site	6 YR	Database Search	IOC, VOC		
79	Car Washing & Polishing	6 YR	Database Search	IOC, VOC, SOC		
80	Trucking-Motor Freight	6 YR	Database Search	VOC, SOC		

SITE#	Source Description <sup>1</sup>	TOT Zone <sup>2</sup> (years)	Source of Information	Potential Contaminants <sup>3</sup>		
81	Nurserymen	6 YR	Database Search	IOC, SOC		
82	Janitor Service	6 YR	Database Search	IOC, VOC, SOC		
83	Laboratories-Medical	6 YR	Database Search	IOC, VOC, SOC		
84	Bicycles-Dealers	6 YR	Database Search	IOC, VOC, SOC		
85	Giftwares-Manufacturers	6 YR	Database Search	IOC, VOC, SOC		
86	Millwork (Manufacturers)	6 YR	Database Search	IOC, VOC, SOC		
87	X-Ray Laboratories	6 YR	Database Search	IOC, VOC, SOC		
88	Service Stations-Gasoline & Oil	6 YR	Database Search	IOC, VOC, SOC		
89	Tree Service	6 YR	Database Search	10C, SOC		
90 91	Automobile Repairing & Service Swimming Pool-Service	6 YR 6 YR	Database Search Database Search	VOC, SOC IOC, SOC		
92	Painters	6 YR	Database Search	IOC, VOC, SOC		
93	Painters	6 YR	Database Search	IOC, VOC, SOC		
94, 103	Cut Stone & Stone Products (Mfrs), RCRA site	6 YR	Database Search	IOC, VOC, SOC		
95	Trailers-Truck (Wholesale)	6 YR	Database Search	VOC, SOC		
96	Truck Renting & Leasing	6 YR	Database Search	IOC, VOC, SOC		
97	Janitor Service	6 YR	Database Search	IOC, VOC, SOC		
98	6001 Cassia, RCRA site	6 YR	Database Search	IOC, VOC, SOC		
100	6627 Overland RD, RCRA site	6 YR	Database Search	IOC, VOC, SOC		
101	6560 W Targee, RCRA site	6 YR	Database Search	IOC, VOC, SOC		
102, 105	Franklin Rd & Allumbaugh, RCRA site, SARA site	6 YR	Database Search	IOC, VOC, SOC		
104	Gasoline Service Station, SARA site	6 YR	Database Search	IOC, VOC, SOC		
106	Amusement and Recreation, SARA site	6 YR	Database Search	IOC		
107	Water Supply, SARA site	6 YR	Database Search	IOC, VOC, SOC		
108, 121	Site Cleanup Incomplete , Impact: Ground Water, LUST site, UST site	10 YR	Database Search	IOC, VOC, SOC		
	Automobile Dealers-New Cars, renting, leasing; LUST site, UST site, RCRA site	10 YR	Database Search	IOC, VOC, SOC		
110, 112	Air Taxi (Airline); Open, UST site, LUST site	10 YR	Database Search	VOC, SOC		
111, 164	Roofing Contractors, UST site	10 YR	Database Search	IOC, VOC, SOC		
113	State Government; Closed, UST site	10 YR	Database Search	VOC, SOC		
	Aircraft Servicing & Maintenance, Commercial; Open, UST site, SARA site	10 YR	Database Search	IOC, VOC, SOC		
116	Gas Station; Open, UST site	10 YR	Database Search	IOC, VOC, SOC		
117, 178	Commercial; Open, UST site, SARA site	10 YR	Database Search	IOC, VOC, SOC		
118	Not Listed; Closed, UST site	10 YR	Database Search	VOC, SOC		
119	Not Listed; Open, UST site	10 YR	Database Search	VOC, SOC		
120, 168	Rental Service-Stores & Yards, UST site	10 YR	Database Search	IOC, VOC, SOC		
122	Home Improvements	10 YR	Database Search	IOC, VOC, SOC		
123 124	Automobile Renting & Leasing Coatings-Protective (Manufacturers)	10 YR 10 YR	Database Search Database Search	IOC, VOC, SOC		
124	Asphalt & Asphalt Products	10 YR	Database Search	IOC, VOC, SOC		
126	Remodeling/Repairing Bldg Contract	10 YR	Database Search	IOC, VOC, SOC		
127	Taxidermists	10 YR	Database Search	IOC, VOC, SOC		
128	Motorcycles & Motor Scooters-Dealers	10 YR	Database Search	IOC, VOC, SOC		
130	Printers	10 YR	Database Search	IOC, VOC		
131	General Contractors	10 YR	Database Search	IOC, VOC, SOC		
133	Compost (Manufacturers)	10 YR	Database Search	IOC, SOC		
132, 174	Paint-Retail, RCRA site	10 YR	Database Search	IOC, VOC, SOC		
134	Funeral Directors	10 YR	Database Search	IOC, VOC, SOC		
135	Automobile Parts & Supplies-Retail	10 YR	Database Search	IOC, VOC, SOC		
136	Automobile Repairing & Service	10 YR	Database Search	IOC, VOC, SOC		
140	Remodeling/Repairing Bldg Contract	10 YR	Database Search	IOC, VOC, SOC		
141	Aircraft Servicing & Maintenance	10 YR	Database Search	IOC, VOC, SOC		
142	Fuel-Economizers	10 YR	Database Search	IOC, VOC, SOC		
143	Automobile Customizing	10 YR	Database Search	10C, VOC, SOC		
144 145	Air Cargo Service Furniture-Repairing & Refinishing	10 YR 10 YR	Database Search Database Search	IOC, VOC, SOC		
146, 147	Automobile Dealers-Used Cars, renting,	10 YR	Database Search	IOC, VOC, SOC		
148	leasing Property Maintenance	10 YR	Database Search	IOC, VOC, SOC		

SITE #	Source Description <sup>1</sup>	TOT Zone <sup>2</sup>	Source of Information	Potential Contaminants <sup>3</sup>
		(years)		
149	General Contractors	10 YR	Database Search	IOC, VOC, SOC
150	Log Cabins Homes & Buildings (mfr)	10 YR	Database Search	IOC, VOC, SOC
151	Paving Contractors	10 YR	Database Search	IOC, VOC, SOC
152	General Contractors	10 YR	Database Search	IOC, VOC, SOC
153	Antiques-Repairing & Restoring	10 YR	Database Search	IOC, VOC, SOC
154	Excavating Contractors	10 YR	Database Search	IOC, VOC, SOC
155	Lawn Mowers-Sharpening & Repairing	10 YR	Database Search	IOC, VOC, SOC
156	General Contractors	10 YR	Database Search	IOC, VOC, SOC
157	Signs (Manufacturers)	10 YR	Database Search	IOC, VOC, SOC
158	Trailers-Truck (Wholesale)	10 YR	Database Search	VOC, SOC
159	General Contractors	10 YR	Database Search	IOC, VOC, SOC
160	Paving Contractors	10 YR	Database Search	IOC, VOC, SOC
161	Roofing Contractors	10 YR	Database Search	IOC, VOC, SOC
162	Industrial Equipment & Supplies	10 YR	Database Search	IOC, VOC, SOC
163	Home Builders	10 YR	Database Search	IOC, VOC, SOC
165	Aircraft Charter Rental & Leasing	10 YR	Database Search	IOC, VOC, SOC
166	Laboratories-Dental	10 YR	Database Search	IOC, VOC, SOC
167	Aircraft-Dealers	10 YR	Database Search	IOC, VOC, SOC
169	Roofing Contractors	10 YR	Database Search	IOC, VOC, SOC
170	Aircraft Charter Rental & Leasing	10 YR	Database Search	IOC, VOC, SOC
171	Federal Government-Transportation	10 YR	Database Search	IOC, VOC, SOC
172	Federal Government-Transportation	10 YR	Database Search	IOC, VOC, SOC
173	Parking Area Maintenance & Marking	10 YR	Database Search	IOC, VOC, SOC
176	RCRA site	10 YR	Database Search	IOC, VOC, SOC
177	Gravel pit	10 YR	Database Search	IOC, VOC, SOC

<sup>&</sup>lt;sup>1</sup>RCRA = Resource Conservation and Recovery Act, SARA = Superfund Amendments and Reauthorization Act., WLAP = Wastewater Land Applications Sites, UST = Underground Storage Tank, LUST = Leaking Underground Storage Tank, CERCLA = Comprehensive Environmental Response Compensation and Liability Act

### Section 3. Susceptibility Analyses

The well's susceptibility to contamination was ranked as high, moderate, or low risk according to the following considerations: hydrologic characteristics, physical integrity of the well, land use characteristics, and potentially significant contaminant sources. The susceptibility rankings are specific to a particular potential contaminant or category of contaminants. Therefore, a high susceptibility rating relative to one potential contaminant does not mean that the water system is at the same risk for all other potential contaminants. The relative ranking that is derived for each well is a qualitative, screening-level step that, in many cases, uses generalized assumptions and best professional judgement. Attachment A contains the susceptibility analysis worksheets. The following summaries describe the rationale for the susceptibility ranking.

#### **Hydrologic Sensitivity**

The hydrologic sensitivity of a well is dependent upon four factors: the surface soil composition, the material in the vadose zone (between the land surface and the water table), the depth to first ground water, and the presence of a 50-foot thick fine-grained zone (aquitard) above the producing zone of the well. Slowly draining soils such as silt and clay typically are more protective of ground water than coarse-grained soils such as sand and gravel. Similarly, fine-grained sediments in the subsurface and a water depth of more than 300 feet protect the ground water from contamination.

<sup>&</sup>lt;sup>2</sup> TOT = time-of-travel (in years) for a potential contaminant to reach the wellhead

<sup>&</sup>lt;sup>3</sup> IOC = inorganic chemical, VOC = volatile organic chemical, SOC = synthetic organic chemical

Well #1 rated high for hydrologic sensitivity. Area soils are moderate to well-drained. In addition, the vadose zone composition, water table depth, and possible presence of an aquitard are unknown. A well log, which was missing during this analysis, would have provided the missing information. If the missing information would have been available, the hydrologic sensitivity score may have been lower.

#### **Well Construction**

Well construction directly affects the ability of the well to protect the aquifer from contaminants. System construction scores are reduced when information shows that potential contaminants will have a more difficult time reaching the intake of the well. Lower scores imply a system is less vulnerable to contamination. For example, if the well casing and annular seal both extend into a low permeability unit, then the possibility of contamination is reduced and the system construction score goes down. If the highest production interval is more than 100 feet below the water table, then the system is considered to have better buffering capacity. If the wellhead and surface seal are maintained to standards, as outlined in sanitary surveys, then contamination down the well bore is less likely. If the well is protected from surface flooding and is outside the 100-year floodplain, then contamination from surface events is reduced.

Well #1 had a high system construction score. The wellhead is outside of the 100-year floodplain and the surface seal is maintained, however, since it does not have a downturned and screened vent at least 18 inches high, it is not considered protected from flooding nor meeting current construction standards. Without a well log, it is unknown if the casing and annular seal extend to low permeability units, or if the highest production comes from more than 100 feet below static water level. A well log would contain the missing information which might lower system construction scores.

Current PWS well construction standards are more stringent than when the well was constructed. The Idaho Department of Water Resources *Well Construction Standards Rules* (1993) require all PWSs to follow DEQ standards as well. IDAPA 58.01.08.550 requires that PWSs follow the *Recommended Standards for Water Works* (1997) during construction. Some of the regulations deal with screening requirements, aquifer pump tests, use of a downturned casing vent, and thickness of casing. Table 1 of the *Recommended Standards for Water Works* (1997) lists the required steel casing thickness for various diameter wells. Six-inch diameter wells require a casing thickness of 0.280 inches. The well was assessed an additional system construction point because the casing thickness was unknown.

### **Potential Contaminant Source and Land Use**

Well #1 rated high for IOCs (i.e. nitrates, arsenic) and VOCs (i.e. petroleum products), moderate for SOCs (i.e. pesticides), and low for microbial contaminants (i.e. bacteria). The high number and location of potential contaminate sources as well as the low agricultural land within the delineation contributed to the scores.

#### **Final Susceptibility Ranking**

A detection above a drinking water standard MCL, any detection of a VOC or SOC, or a detection of total coliform bacteria or fecal coliform bacteria at the wellhead will automatically give a high susceptibility rating to a well despite the land use of the area because a pathway for contamination already exists. Additionally, potential contaminant sources within 50 feet of a wellhead will automatically lead to a high susceptibility rating. Hydrologic sensitivity and system construction scores are heavily weighted in the final scores. Having multiple potential contaminant sources in the 0- to 3-

year time of travel zone (Zone 1B) contribute greatly to the overall ranking. Well #1 automatically rated high for IOCs, VOCs, SOCs, and microbials due to the mobile homes existing within the 50 foot sanitary setback distance. In addition, arsenic was detected (December 1995) in concentrations higher than the currently revised MCL.

Table 2. Summary of Krizview Park Susceptibility Evaluation

		Susceptibility Scores <sup>1</sup>									
	Hydrologic Sensitivity			ntaminan nventory	t	System Construction	Final Susceptibility Ranking				
Well		IOC	VOC	SOC	Microbials		IOC	VOC	SOC	Microbials	
Well #1	Н	Н	Н	M	L	Н	Н*	Н*	Н*	H*	

<sup>&</sup>lt;sup>1</sup>H = High Susceptibility, M = Moderate Susceptibility, L = Low Susceptibility,

 $H^*$ = automatic high due to mobile homes existing within well's 50 foot sanitary setback distance. Arsenic (IOC) over allowable limit (December 1995)

#### **Susceptibility Summary**

The Krizview Park (PWS #4010178) drinking water system consists of one well. The system currently serves 120 people through 32 connections. Little is known about the well's history except that its casing extends to a depth of 54 feet. No information was available as to when it was constructed.

In terms of total susceptibility, Well #1 rates automatically high for IOCs, VOCs, SOC, and microbials. The automatically high ratings are due to the presence of mobile homes within 50 feet of the well. System construction scores and hydrologic sensitivity scores were both high. The missing well log might have lowered the scores. Land use scores were high IOCs and VOCs, moderate for SOCs, and low for microbials.

No SOCs have ever been tested in the well. Traces of fluoride and nitrate have been detected, but at levels significantly below the MCL. Total coliform and fecal coliform have been detected in the distribution system (March 2000). The arsenic detection was at a concentration of 13 ppb, a level greater than the revised MCL of 10 ppm. In October 2001, the EPA lowered the arsenic MCL from 50 ppm to 10 ppm. However, public water systems have until 2006 to meet the new requirement.

# **Section 4. Options for Drinking Water Protection**

The susceptibility assessment should be used as a basis for determining appropriate new protection measures or re-evaluating existing protection efforts. No matter what the susceptibility ranking a source receives, protection is always important. Whether the source is currently located in a "pristine" area or an area with numerous industrial and/or agricultural land uses that require surveillance, the way to ensure good water quality in the future is to act now to protect valuable water supply resources. If the system should need to expand in the future, new well sites should be located in areas with as few potential sources of contamination as possible, and the site should be reserved and protected for this specific use.

IOC = inorganic chemical, VOC = volatile organic chemical, SOC = synthetic organic chemical

An effective drinking water protection program is tailored to the particular local drinking water protection area. A community with a fully developed drinking water protection program will incorporate many strategies. For Krizview Park, drinking water protection activities should first focus on correcting any deficiencies outlined in the sanitary survey. Actions should be taken to keep a 50-foot radius circle clear around the wellhead. Any spills within the delineation should be carefully monitored and dealt with. As much of the designated protection area is outside the direct jurisdiction Krizview Park, making collaboration and partnerships with state and local agencies and industry groups are critical to the success of drinking water protection. The well should maintain sanitary standards regarding wellhead protection.

Due to the time involved with the movement of ground water, drinking water protection activities should be aimed at long-term management strategies even though these strategies may not yield results in the near term. A strong public education program should be a primary focus of any drinking water protection plan as the delineation contains some urban and residential land uses. Public education topics could include proper lawn and garden care practices, household hazardous waste disposal methods, proper care and maintenance of septic systems, and the importance of water conservation to name but a few. There are multiple resources available to help communities implement protection programs, including the Drinking Water Academy of the U.S. EPA. Drinking water protection activities for agriculture should be coordinated with the Idaho State Department of Agriculture, the Soil Conservation Commission, Ada Soil and Water Conservation District, and the Natural Resources Conservation Service.

A community must incorporate a variety of strategies in order to develop a comprehensive drinking water protection plan, be they regulatory in nature (i.e. zoning, permitting) or non-regulatory in nature (i.e. good housekeeping, public education, specific best management practices). For assistance in developing protection strategies please contact the Boise Regional Office of the DEQ or the Idaho Rural Water Association.

#### **Assistance**

Public water supplies and others may call the following DEQ offices with questions about this assessment and to request assistance with developing and implementing a local protection plan. In addition, draft protection plans may be submitted to the DEQ office for preliminary review and comments.

Boise Regional DEO Office (208) 373-0550

State DEQ Office (208) 373-0502

Website: http://www.deq.state.id.us

Water suppliers serving fewer than 10,000 persons may contact Melinda Harper, Idaho Rural Water Association, at (208)343-7001 (mharper@idahoruralwater.com) for assistance with drinking water protection (formerly wellhead protection) strategies.

# POTENTIAL CONTAMINANT INVENTORY LIST OF ACRONYMS AND DEFINITIONS

<u>AST (Aboveground Storage Tanks)</u> – Sites with aboveground storage tanks.

<u>Business Mailing List</u> – This list contains potential contaminant sites identified through a yellow pages database search of standard industry codes (SIC).

<u>CERCLIS</u> – This includes sites considered for listing under the <u>Comprehensive Environmental Response Compensation</u> and <u>Liability Act (CERCLA)</u>. CERCLA, more commonly known as <u>ASuperfund@</u> is designed to clean up hazardous waste sites that are on the national priority list (NPL).

<u>Cyanide Site</u> – DEQ permitted and known historical sites/facilities using cyanide.

<u>Dairy</u> – Sites included in the primary contaminant source inventory represent those facilities regulated by Idaho State Department of Agriculture (ISDA) and may range from a few head to several thousand head of milking cows.

<u>Deep Injection Well</u> – Injection wells regulated under the Idaho Department of Water Resources generally for the disposal of stormwater runoff or agricultural field drainage.

**Enhanced Inventory** – Enhanced inventory locations are potential contaminant source sites added by the water system. These can include new sites not captured during the primary contaminant inventory, or corrected locations for sites not properly located during the primary contaminant inventory. Enhanced inventory sites can also include miscellaneous sites added by the Idaho Department of Environmental Quality (DEQ) during the primary contaminant inventory.

**Floodplain** – This is a coverage of the 100year floodplains.

<u>Group 1 Sites</u> – These are sites that show elevated levels of contaminants and are not within the priority one areas.

<u>Inorganic Priority Area</u> – Priority one areas where greater than 25% of the wells/springs show constituents higher than primary standards or other health standards.

<u>Landfill</u> – Areas of open and closed municipal and non-municipal landfills.

<u>LUST (Leaking Underground Storage Tank)</u> – Potential contaminant source sites associated with leaking underground storage tanks as regulated under RCRA.

<u>Mines and Quarries</u> – Mines and quarries permitted through the Idaho Department of Lands.)

<u>Nitrate Priority Area</u> – Area where greater than 25% of wells/springs show nitrate values above 5mg/l.

#### NPDES (National Pollutant Discharge Elimination System)

 Sites with NPDES permits. The Clean Water Act requires that any discharge of a pollutant to waters of the United States from a point source must be authorized by an NPDES permit.

<u>Organic Priority Areas</u> – These are any areas where greater than 25 % of wells/springs show levels greater than 1% of the primary standard or other health standards.

<u>Recharge Point</u> – This includes active, proposed, and possible recharge sites on the Snake River Plain.

**RICRIS** – Site regulated under **Resource Conservation Recovery Act (RCRA)**. RCRA is commonly associated with the cradle to grave management approach for generation, storage, and disposal of hazardous wastes.

SARA Tier II (Superfund Amendments and Reauthorization Act Tier II Facilities) – These sites store certain types and amounts of hazardous materials and must be identified under the Community Right to Know Act.

Toxic Release Inventory (TRI) – The toxic release inventory list was developed as part of the Emergency Planning and Community Right to Know (Community Right to Know) Act passed in 1986. The Community Right to Know Act requires the reporting of any release of a chemical found on the TRI list.

<u>UST (Underground Storage Tank)</u> – Potential contaminant source sites associated with underground storage tanks regulated as regulated under RCRA.

<u>Wastewater Land Applications Sites</u> – These are areas where the land application of municipal or industrial wastewater is permitted by DEQ.

<u>Wellheads</u> – These are drinking water well locations regulated under the Safe Drinking Water Act. They are not treated as potential contaminant sources.

**NOTE:** Many of the potential contaminant sources were located using a geocoding program where mailing addresses are used to locate a facility. Field verification of potential contaminant sources is an important element of an enhanced inventory.

Where possible, a list of potential contaminant sites unable to be located with geocoding will be provided to water systems to determine if the potential contaminant sources are located within the source water assessment area.

#### **References Cited**

- Anderson, J.E. and Wood, S.H., 1981. Geological, Hydrological Geochemical and Geophysical Investigations of the Nampa-Caldwell and Adjacent Areas, Southwestern Idaho. Chapter 3, Geohydrology, In: Mitchell, J. C., ed., Geothermal Investigations in Idaho, Part 11: Idaho Department of Water Resources, Water Information Bulletin 30: p. 33-42.
- Clemens, D.M., 1993. Volcanic stratigraphy and tectonic development, Western Snake River Plain, Idaho. M.S. Thesis, Arizona State University.
- Great Lakes-Upper Mississippi River Board of State and Provincial Public Health and Environmental Managers, 1997. "Recommended Standards for Water Works."
- Idaho Department of Agriculture, 1998. Unpublished Data.
- Idaho Department of Environmental Quality, 1995. Groundwater Under Direct Influence (GWUDI) Field Survey Report.
- Idaho Department of Environmental Quality, 1997. Design Standards for Public Drinking Water Systems. IDAPA 58.01.08.550.01.
- Idaho Department of Water Resources, 1993. Administrative Rules of the Idaho Water Resource Board: Well Construction Standards Rules. IDAPA 37.03.09.
- Malde, H.E., 1991. Quaternary geology and structural history of the Snake River Plain, Idaho and Oregon. In: The Geology of North America, Quaternary Nonglacial Geology: Conterminous U.S., Vol. K-2, 252-281 pp.
- Malde, H.E. and Powers, H.A., 1962. Upper Cenozoic stratigraphy of Western Snake River Plain. Geological Society of America Bulletin, 73: 1197-1220.
- Neely, K.W. and J.K. Crockett, 1998. "Ground Water Quality Characterization and Initial Trend Analyses for the Treasure Valley Shallow and Deep Hydrogeologic Subareas," Idaho Department of Water Resources, Water Information Bulletin No. 50, Part 3.
- Othberg, K.L., 1994. Geology and geomorphology of the Boise Valley and adjoining areas, western Snake River Plain, Idaho. Idaho Geological Survey Bulletin 29: 54 pp.
- Othberg, K.L. and Stanford, L., 1992. Geologic map of the Boise Valley and adjoining area, Western Snake River Plain, Idaho. Idaho Geological Survey.
- Petrich, C.R. and S.M. Urban, 1996. "Treasure Valley Hydrologic Project Background Draft," September, 1996.
- Petrich, C.R. and J.H. Hutchings (IWRRI), S.M. Urban and R.A. Carlson (IDWR), 1999. "Progress Report on the Characterization of Treasure Valley Ground Water Resources Draft," prepared for and in cooperation with the Idaho Department of Water Resources, June 30, 1999.

- Squires, E., Wood, S.H. and Osiensky, J.L., 1992. Hydrogeologic Framework of the Boise Aquifer System, Ada County, Idaho, Research Technical Completion Report, Idaho Water Resources Research Institute, University of Idaho. 114 pp.
- Wood, S.H., 1994. Seismic expression and geological significance of a lacustrine delta in Neogene deposits of the Western Snake River Plain, Idaho. AAPG Bulletin, 1(January): p. 102-121.
- Wood, S.H. and Anderson, J.E., 1981. Part 11: Geological, hydrological, and geochemical and Geophysical investigations of the Nampa-Caldwell and adjacent areas, southwestern Idaho. In: J.C. Mitchell (Editor), Geothermal investigations in Idaho. Idaho Department of Water Resources.
- Wuolo, R.W., J. Wittman, and D.M. Reynolds, 2001. "Summary Report: Delineation of Public Drinking Water Sources for the Source Water Assessment Program: Boise Valley and Mountain Home Plateau," BARR, Minneapolis, August 2001.

# Attachment A

Krizview Park
Susceptibility Analysis
Worksheets

The final scores for the susceptibility analysis were determined using the following formulas:

- 1) VOC/SOC/IOC Final Score = Hydrologic Sensitivity + System Construction + (Potential Contaminant/Land Use x 0.2)
- 2) Microbial Final Score = Hydrologic Sensitivity + System Construction + (Potential Contaminant/Land Use x 0.375)

Final Susceptibility Scoring:

- 0 5 Low Susceptibility
- 6 12 Moderate Susceptibility
- ≥ 13 High Susceptibility

Ground Water Susceptibility Report Public Water System Name : KRIZVIEW PARK Well# : WELL #1 04/16/2002 12:40:46 PM

Public Water System Number 4010178

Drill Date unknown Driller Log Available NO Sanitary Survey (if yes, indicate date of last survey) Well meets IDWR construction standards Wellhead and surface seal maintained NO Casing and annular seal extend to low permeability unit NO Highest production 100 feet below static water level NO Well located outside the 100 year flood plain NO  Total System Construction Score  P. Hydrologic Sensitivity  Soils are poorly to moderately drained NO Vadose zone composed of gravel, fractured rock or unknown YES Depth to first water > 300 feet NO Aquitard present with > 50 feet cumulative thickness  Total Hydrologic Score	1993 1 1 2 1 1 6	VOC		
Driller Log Available NO Sanitary Survey (if yes, indicate date of last survey) YES Well meets IDWR construction standards NO Wellhead and surface seal maintained NO Casing and annular seal extend to low permeability unit NO Highest production 100 feet below static water level NO Well located outside the 100 year flood plain NO  Total System Construction Score  P. Hydrologic Sensitivity  Soils are poorly to moderately drained NO Vadose zone composed of gravel, fractured rock or unknown YES Depth to first water > 300 feet NO Aquitard present with > 50 feet cumulative thickness NO  Total Hydrologic Score	1 1 2 1 1 1 6 2 1 1 2 2 1 1 0			
Sanitary Survey (if yes, indicate date of last survey)  Well meets IDWR construction standards  Wellhead and surface seal maintained  Casing and annular seal extend to low permeability unit  Highest production 100 feet below static water level  Well located outside the 100 year flood plain  Total System Construction Score  Hydrologic Sensitivity  Soils are poorly to moderately drained  Vadose zone composed of gravel, fractured rock or unknown  Depth to first water > 300 feet  Aquitard present with > 50 feet cumulative thickness  Total Hydrologic Score	1 1 2 1 1 1 6 2 1 1 2 2 1 1 0			
Well meets IDWR construction standards Wellhead and surface seal maintained NO Casing and annular seal extend to low permeability unit NO Highest production 100 feet below static water level NO Well located outside the 100 year flood plain NO  Total System Construction Score  Hydrologic Sensitivity  Soils are poorly to moderately drained Vadose zone composed of gravel, fractured rock or unknown Depth to first water > 300 feet NO Aquitard present with > 50 feet cumulative thickness  Total Hydrologic Score	1 1 2 1 1 1 6 2 1 1 2 2 1 1 0			
Wellhead and surface seal maintained NO Casing and annular seal extend to low permeability unit NO Highest production 100 feet below static water level NO Well located outside the 100 year flood plain NO  Total System Construction Score  Hydrologic Sensitivity  Soils are poorly to moderately drained NO Vadose zone composed of gravel, fractured rock or unknown YES Depth to first water > 300 feet NO Aquitard present with > 50 feet cumulative thickness NO  Total Hydrologic Score	1 2 1 1			
Casing and annular seal extend to low permeability unit  Highest production 100 feet below static water level  Well located outside the 100 year flood plain  Total System Construction Score  Hydrologic Sensitivity  Soils are poorly to moderately drained Vadose zone composed of gravel, fractured rock or unknown  Depth to first water > 300 feet  Aquitard present with > 50 feet cumulative thickness  Total Hydrologic Score	2 1 1 6 			
Highest production 100 feet below static water level NO Well located outside the 100 year flood plain NO  Total System Construction Score  Hydrologic Sensitivity  Soils are poorly to moderately drained NO Vadose zone composed of gravel, fractured rock or unknown YES Depth to first water > 300 feet NO Aquitard present with > 50 feet cumulative thickness NO  Total Hydrologic Score	1 1 6 2 1 1 2			
Highest production 100 feet below static water level NO Well located outside the 100 year flood plain NO  Total System Construction Score  Hydrologic Sensitivity  Soils are poorly to moderately drained NO Yadose zone composed of gravel, fractured rock or unknown YES Depth to first water > 300 feet NO Aquitard present with > 50 feet cumulative thickness NO  Total Hydrologic Score	1 6 2 1 1 2 2 1 1 1 2 1 1 1 2 1 1 1 1 1			
Well located outside the 100 year flood plain  Total System Construction Score  Hydrologic Sensitivity  Soils are poorly to moderately drained Vadose zone composed of gravel, fractured rock or unknown Depth to first water > 300 feet Aquitard present with > 50 feet cumulative thickness  Total Hydrologic Score	1 6 2 1 1 2 2 1 1 1 2 1 1 1 2 1 1 1 1 1			
Total System Construction Score  Hydrologic Sensitivity  Soils are poorly to moderately drained Vadose zone composed of gravel, fractured rock or unknown Depth to first water > 300 feet Aquitard present with > 50 feet cumulative thickness  Total Hydrologic Score	2 1 1 2 6			
. Hydrologic Sensitivity  Soils are poorly to moderately drained NO Vadose zone composed of gravel, fractured rock or unknown Depth to first water > 300 feet NO Aquitard present with > 50 feet cumulative thickness  Total Hydrologic Score	2 1 1 2 6			
Soils are poorly to moderately drained NO Vadose zone composed of gravel, fractured rock or unknown YES Depth to first water > 300 feet NO Aquitard present with > 50 feet cumulative thickness NO  Total Hydrologic Score	1 1 2 6 IOC			
Vadose zone composed of gravel, fractured rock or unknown  Depth to first water > 300 feet  Aquitard present with > 50 feet cumulative thickness  Total Hydrologic Score	1 1 2 6 IOC			
Depth to first water > 300 feet NO Aquitard present with > 50 feet cumulative thickness NO  Total Hydrologic Score	1 2 6 IOC			
Aquitard present with > 50 feet cumulative thickness NO	2 6 IOC			
Total Hydrologic Score	6 IOC			
Total Hydrologic Score	IOC			
	Score	Score	SOC	Microbial
Potential Contaminant / Land Use - ZONE 1A		20010	Score	Score
Land Use Zone 1A URBAN/COMMERCIAL	2	2	2	2
Farm chemical use high NO	0	0	0	
IOC, VOC, SOC, or Microbial sources in Zone 1A YES	YES	YES	YES	YES
Total Potential Contaminant Source/Land Use Score - Zone 1A	2	2	2	2
Potential Contaminant / Land Use - ZONE 1B				
Contaminant sources present (Number of Sources)  YES	42	46	42	7
(Score = # Sources X 2 ) 8 Points Maximum	8	8	8	8
Sources of Class II or III leacheable contaminants or YES	15	15	15	
4 Points Maximum	4	4	4	
Zone 1B contains or intercepts a Group 1 Area YES	2	2	0	0
Land use Zone 1B Less Than 25% Agricultural Land	0	0	0	0
Total Potential Contaminant Source / Land Use Score - Zone 1B	14	14	12	8
Potential Contaminant / Land Use - ZONE II				
Gardania Gardania Darrania VIII				
Contaminant Sources Present YES Sources of Class II or III leacheable contaminants or YES	2 1	2 1	2 1	
	0	0	U T	
Land Use Zone II Less than 25% Agricultural Land	-		o o	
Potential Contaminant Source / Land Use Score - Zone II	3	3	3	0
Potential Contaminant / Land Use - ZONE III				
Contaminant Source Present YES	1	1	1	
Sources of Class II or III leacheable contaminants or YES	1	1	1	
Is there irrigated agricultural lands that occupy > 50% of NO	0	0	0	
Total Potential Contaminant Source / Land Use Score - Zone III	2	2	2	0
Cumulative Potential Contaminant / Land Use Score	21	21	19	10
Final Susceptibility Source Score	16	16	16	16
. Final Well Ranking	High	High	High	High